




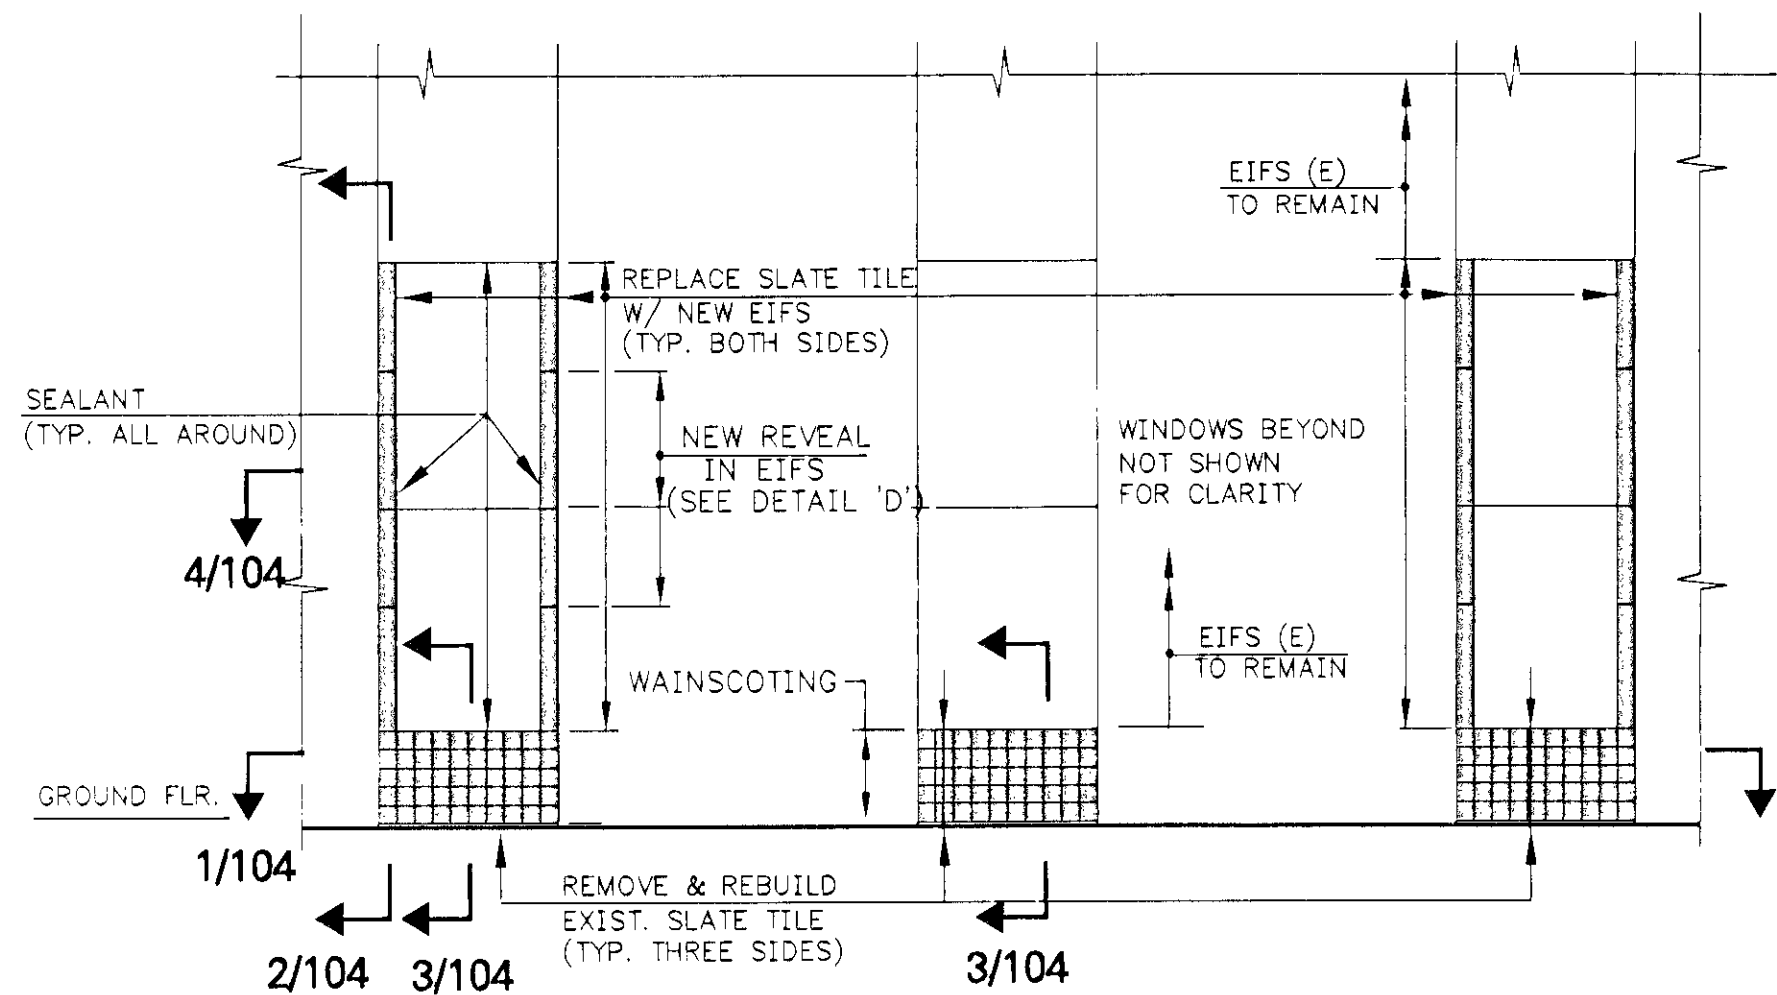

BUILDING PARTIAL ELEVATION
SCALE: 3/16"=1'-0"

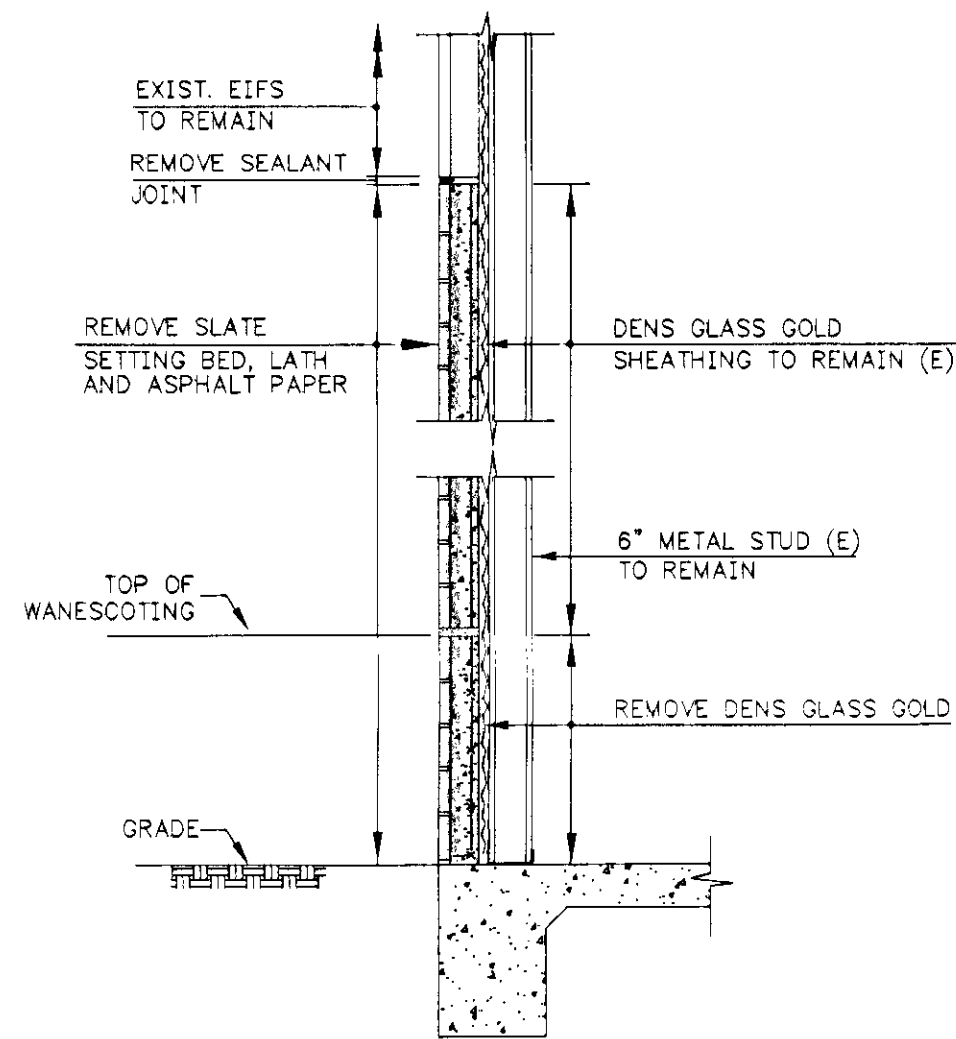


DEMOLITION

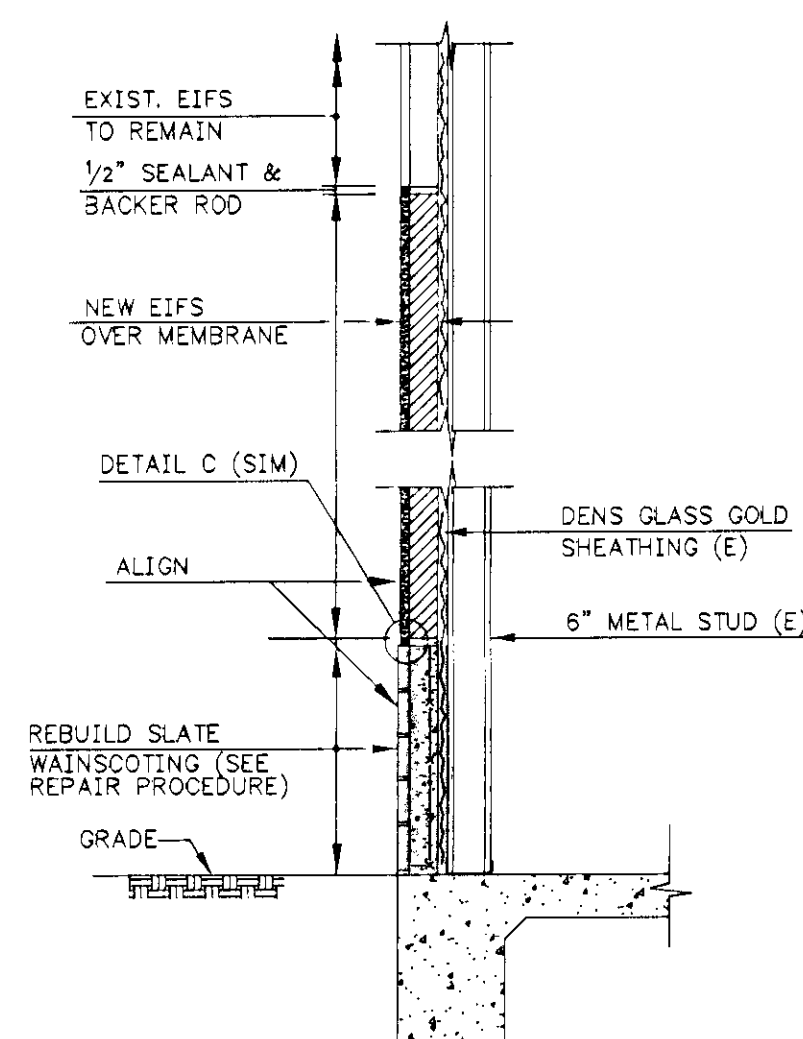

REBUILD


SECTION 2/104
SCALE: 1/2"=1'-0"

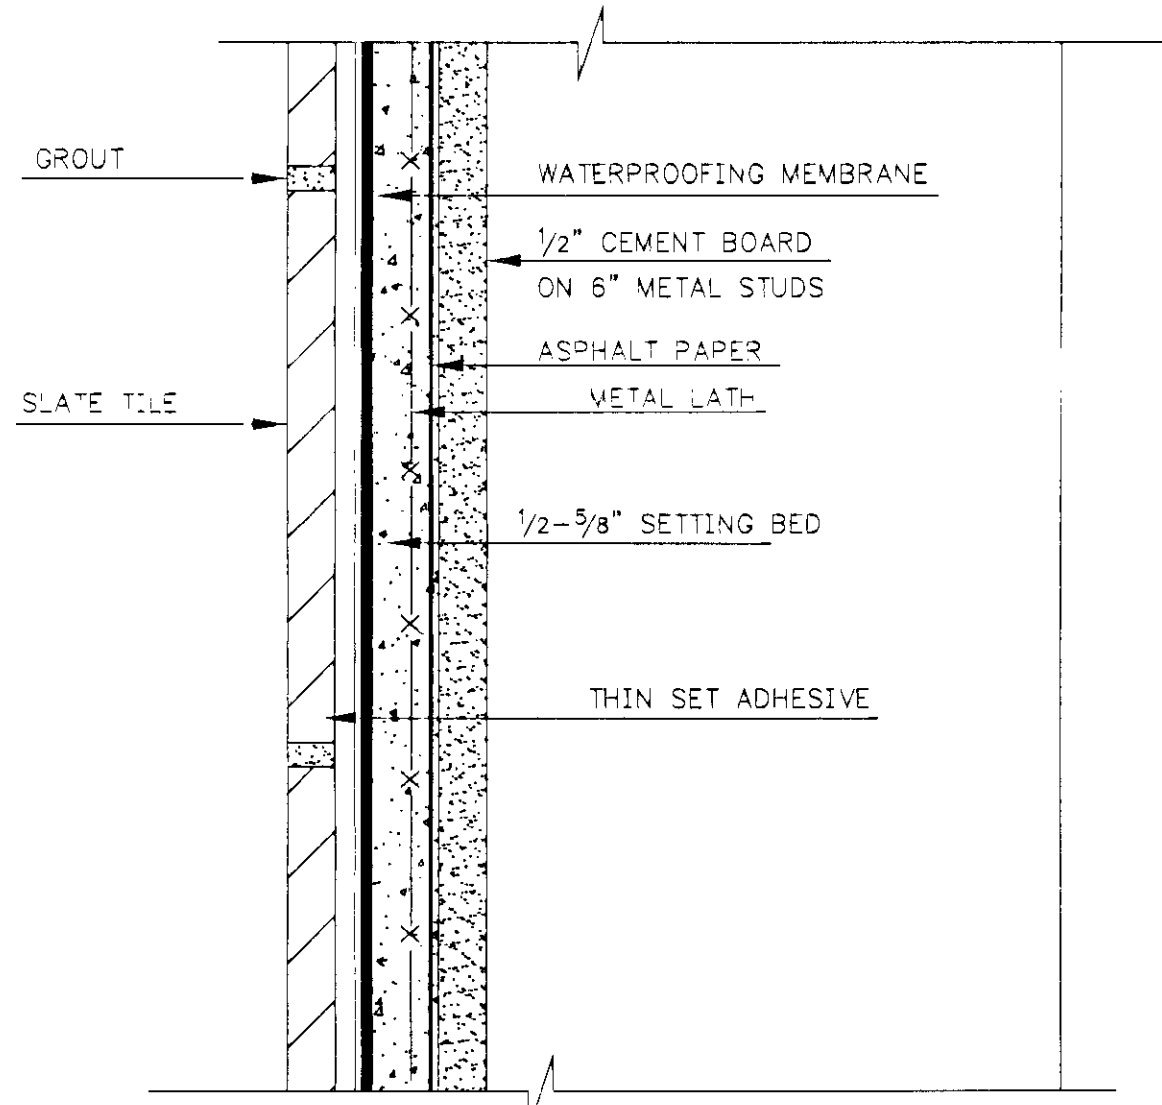


TYPICAL SLATE TILE REBUILD
SCALE: 3/4"=1'-0"

REPAIR PROCEDURE


- 1) REMOVE AND DISPOSE OF ALL EXISTING SLATE TILE.
- 2) REMOVE ALL EXISTING SETTING BED, METAL LATH, AND ASPHALT PAPER, AND DENS GLASS GOLD
- 3) INSTALL NEW 1/2" CEMENT BOARD, SETTING BED, METAL LATH, AND WATERPROOFING.
- 4) INSTALL NEW SLATE TILE ON SETTING BED APPLY WITH NOTCHED TROWEL AND BACK BUTTER.
- 5) GROUT SLATE TILE JOINTS AND CLEAN.
- 6) INSTALL EIFS AND SEALANT.

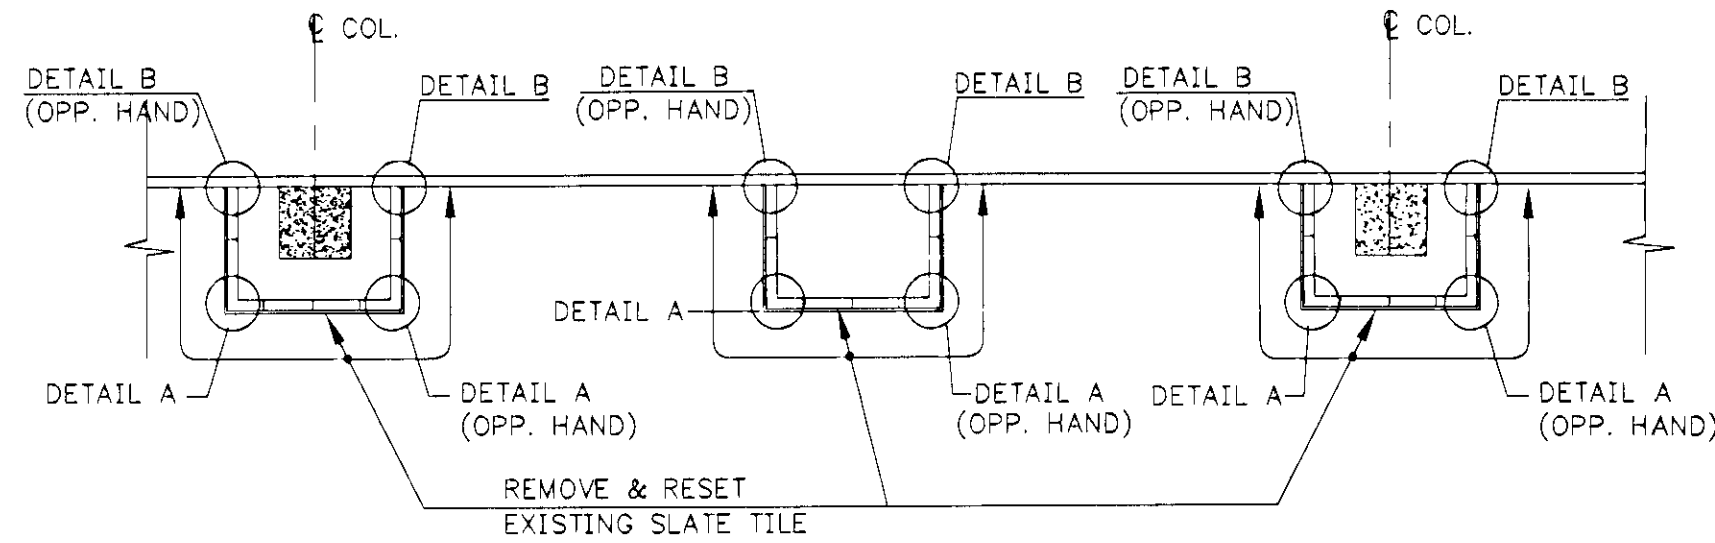

SECTION 1/104
SCALE: 3/16"=1'-0"

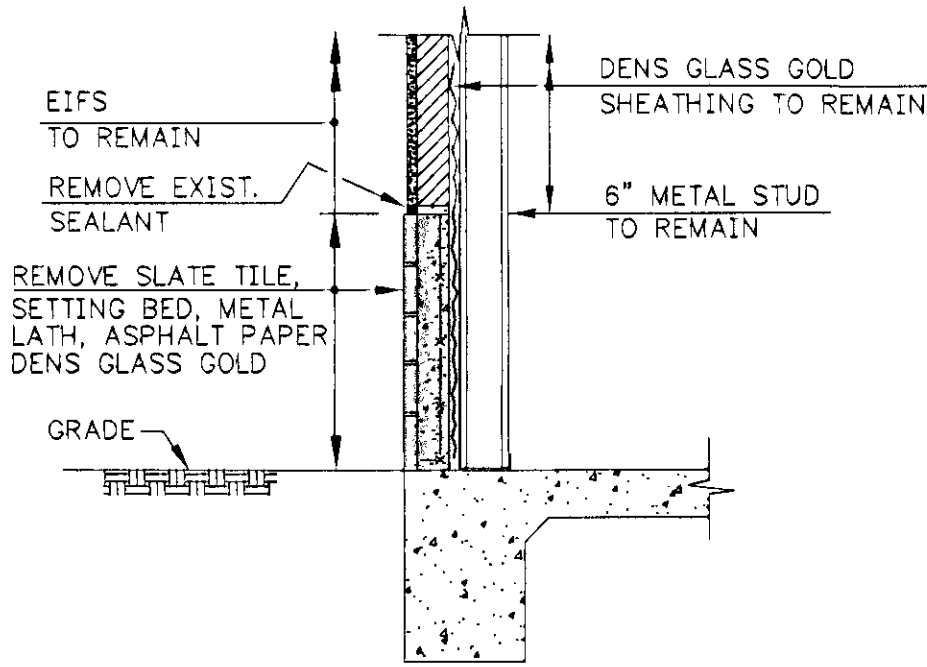


DEMOLITION

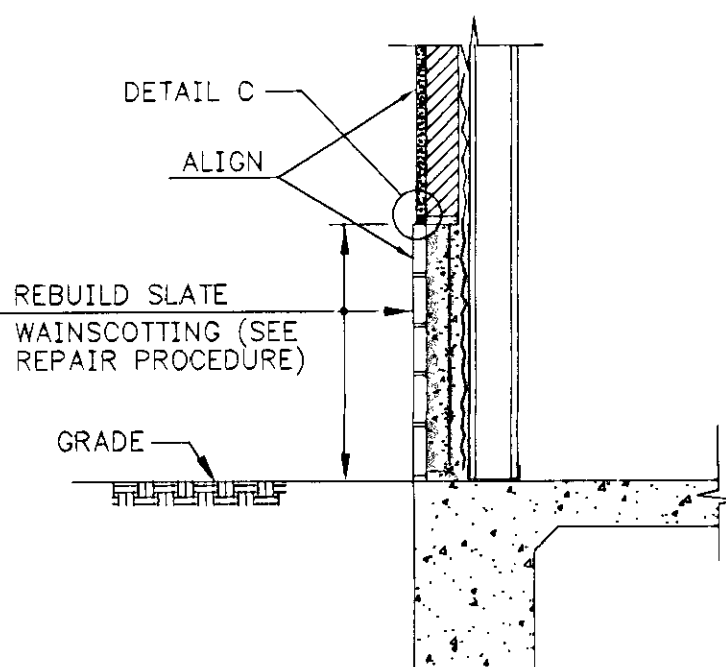


REBUILD

SECTION 3/104
SCALE: 1/2"=1'-0"

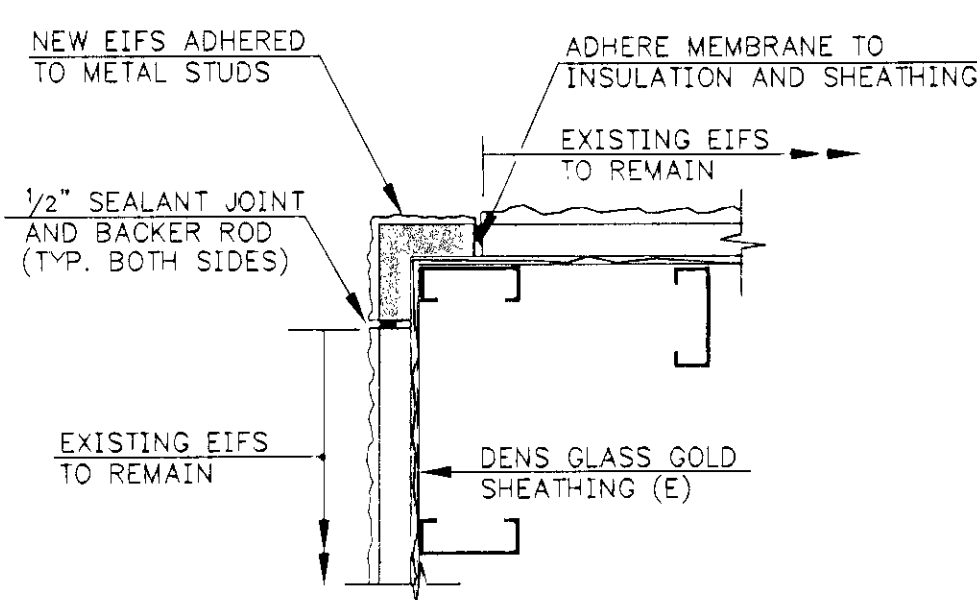


SECTION 4/104
SCALE: 1"=1'-0"

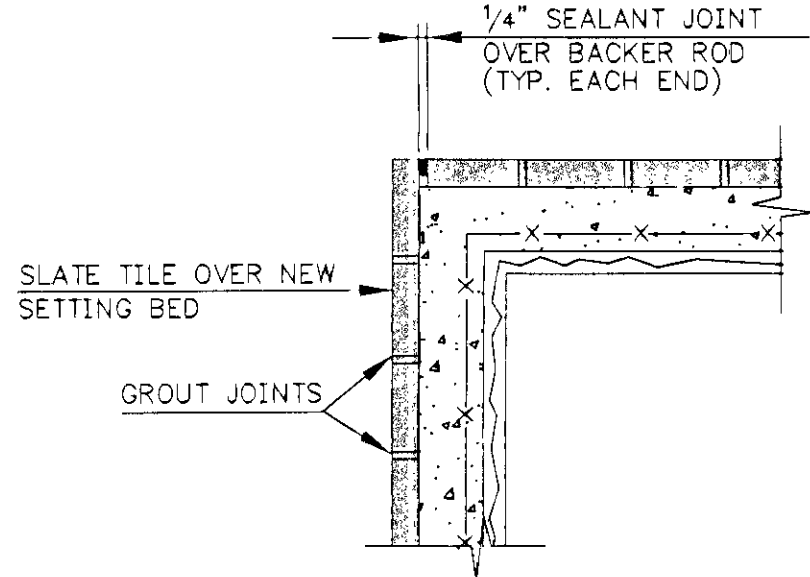


DETAIL 'A'
SCALE: 1"=1'-0"

WAINSCOTING OUTSIDE CORNER

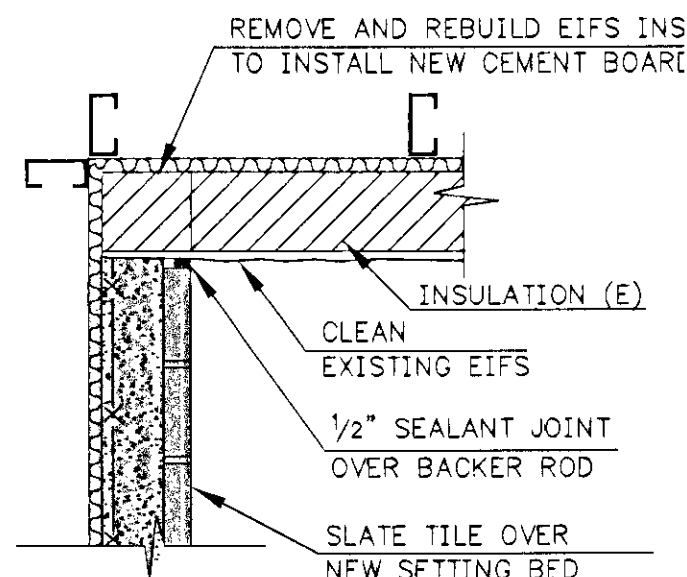


DETAIL 'B'
SCALE: 1"=1'-0"


WAINSCOTING INSIDE CORNER

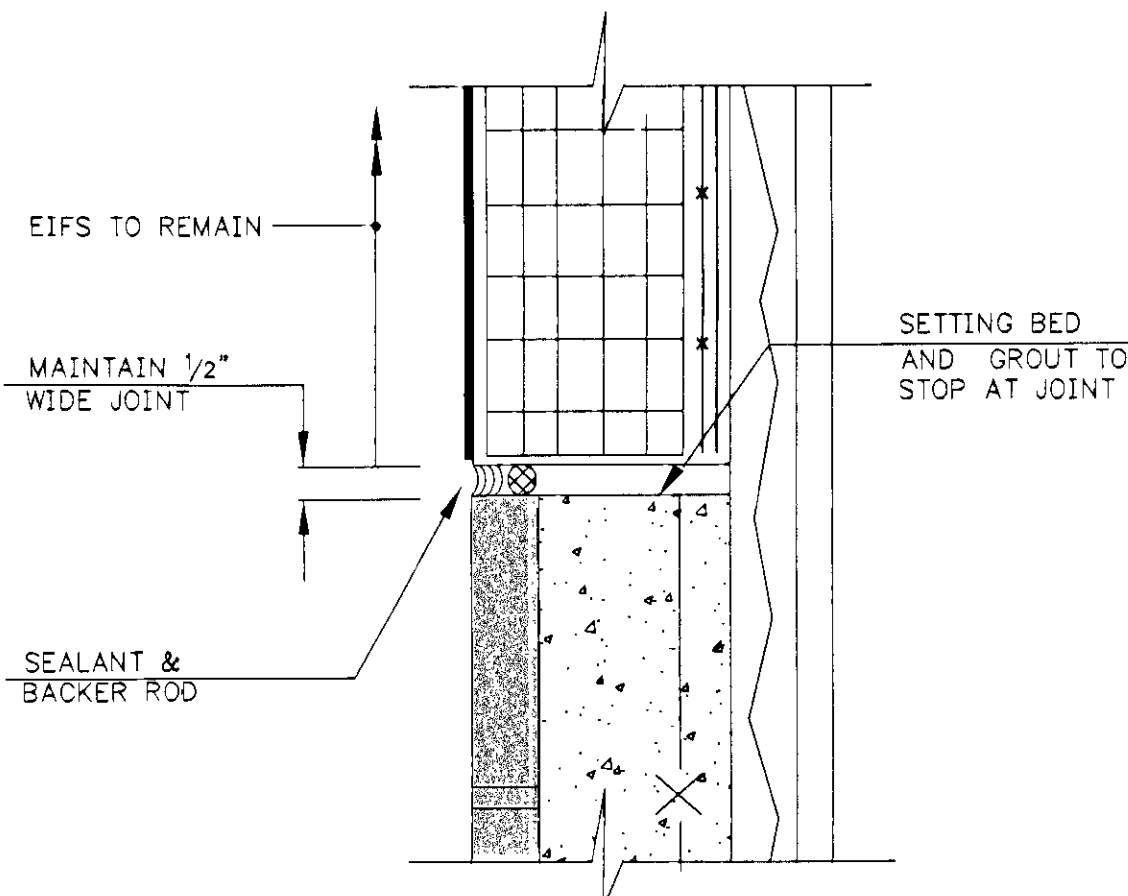

DETAIL 'C'

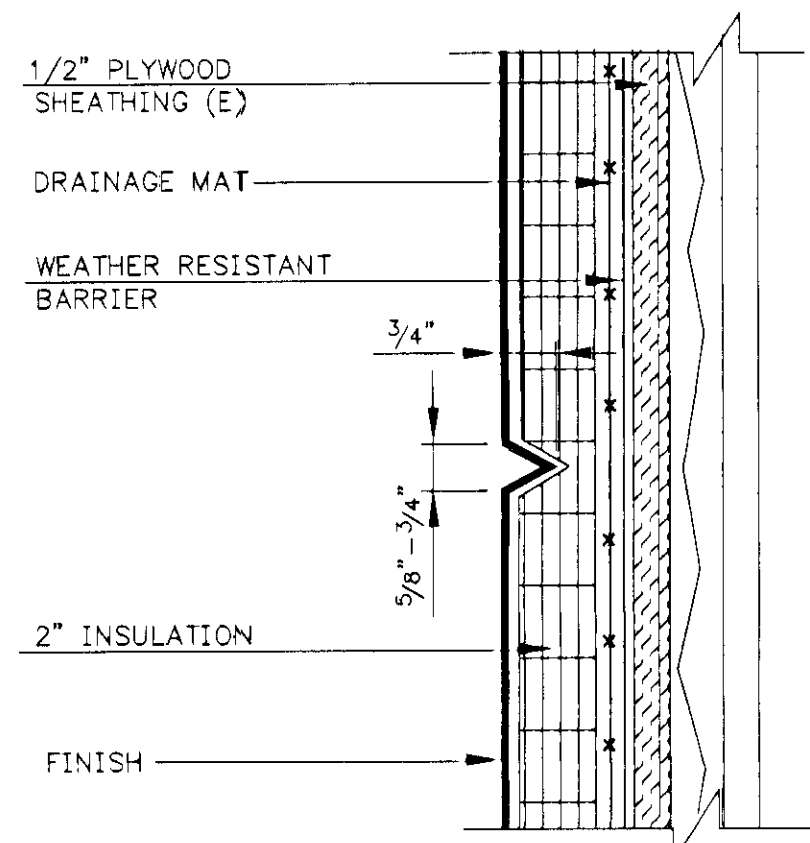

DETAIL 'D'
SCALE: 1/2"=1'-0"
NEW REVEAL IN EIFS

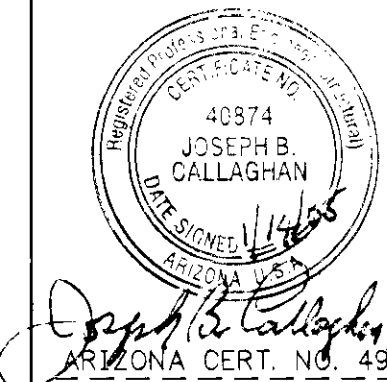

NO.	DATE	DESCRIPTION	BY
REVISIONS			
PROJECT			
THE VANGUARD GROUP THE NORTHSIGHT OFFICE CAMPUS SCOTTSDALE, AZ.			
EXTERIOR SLATE TILE REPAIR			
DRAWING TITLE			
REPAIR SECTIONS & DETAILS			
DRAWN JAB	CHECKED AR	APPROVED JBC	DRAWING NO. 104
DATE 1/14/05	SCALE AS SHOWN	PROJECT NO. 05-3203	Sheet 5 of 5
JOSEPH B. CALLAGHAN, INC. - CONSULTING ENGINEERS 1655 SUBURBAN STATION BUILDING - 1817 JOHN P. KENNEDY BLVD. PHILADELPHIA, PENNSYLVANIA 19103 (215) 665-0497 FAX (215) 665-1345			